

RF-01 Cementies 1.0 M Long, Drilled & Grouted Into Outer Ring Of Barrel, End Turned Across Face Of Arch Rings & Grouted Into Beam / Crack Stitch Slots.

Rebuild Inner Brick Ring To Spandrel Face

Bulging Spandrel Face, Weak Stonework


Twin Helibeam 60 Installed full Width Of Barrel, Ends Turned Across Spandrel. To Tie Cracks In Barrel Vault.

End Turned Into Grouted Area 1.0 m

Single Helibar 60 Installed at Mid Points Between Twin Helibeam 60 Full Width Of Barrel, Ends Turned Across Spandrel.

RF-01 Cementie End Turned Across Spandrel Face

LB-04 Helibeam Extends To Opposite Spandrel

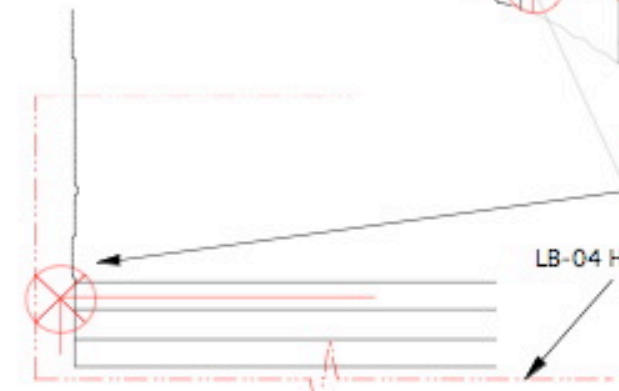

Section AA

TRAC Structural Ltd
 Providing Solutions For Masonry Repair
 23 Belvoir Road St Andrews Bristol BS6 5DQ
 Tel: 0117 924 0224 Fax 0117 924 8574

Glebe Bridge
 Stanton St Quentin
 Downstream Elevation
 Helifix Reinforcement

DATE	18/9/01	BY	SHC
SCALE	1:25	NO.	TSP 626 D2
			AA